

Three New Sonnax

Solutions for AW 55-50

You asked us to help you solve more problems with the Aisin Warner 55-50SN - Sonnax delivers!

1. 59947-12K
Oversized Pressure Regulator Valve & Boost Valve Kit



Helps cure:

- Delayed engagements & harsh reverse
- TCC slip or engine stall

2. 59947-07K
Main Boost Valve & Sleeve Kit

Helps cure:

- Slip in reverse
- Poor upshift

3. 59947-16K
Secondary Regulator Valve & Spring Kit



Helps cure:

- Overheating of fluid, bushings & converter
- Harsh reverse engagement

4. 59947-LPC
LPC Accumulator Piston Kit

Helps cure:

- Delayed forward engagement
- Low line, lube & converter pressure

5. 59947-21K (4 Small & 1 Large)
O-Ringed End Plug Kit


Helps cure:

- Delayed forward engagement
- 2-3 up-shift flare, low SLT pressure

NEW! 5.

NEW! 3.

NEW! 4.

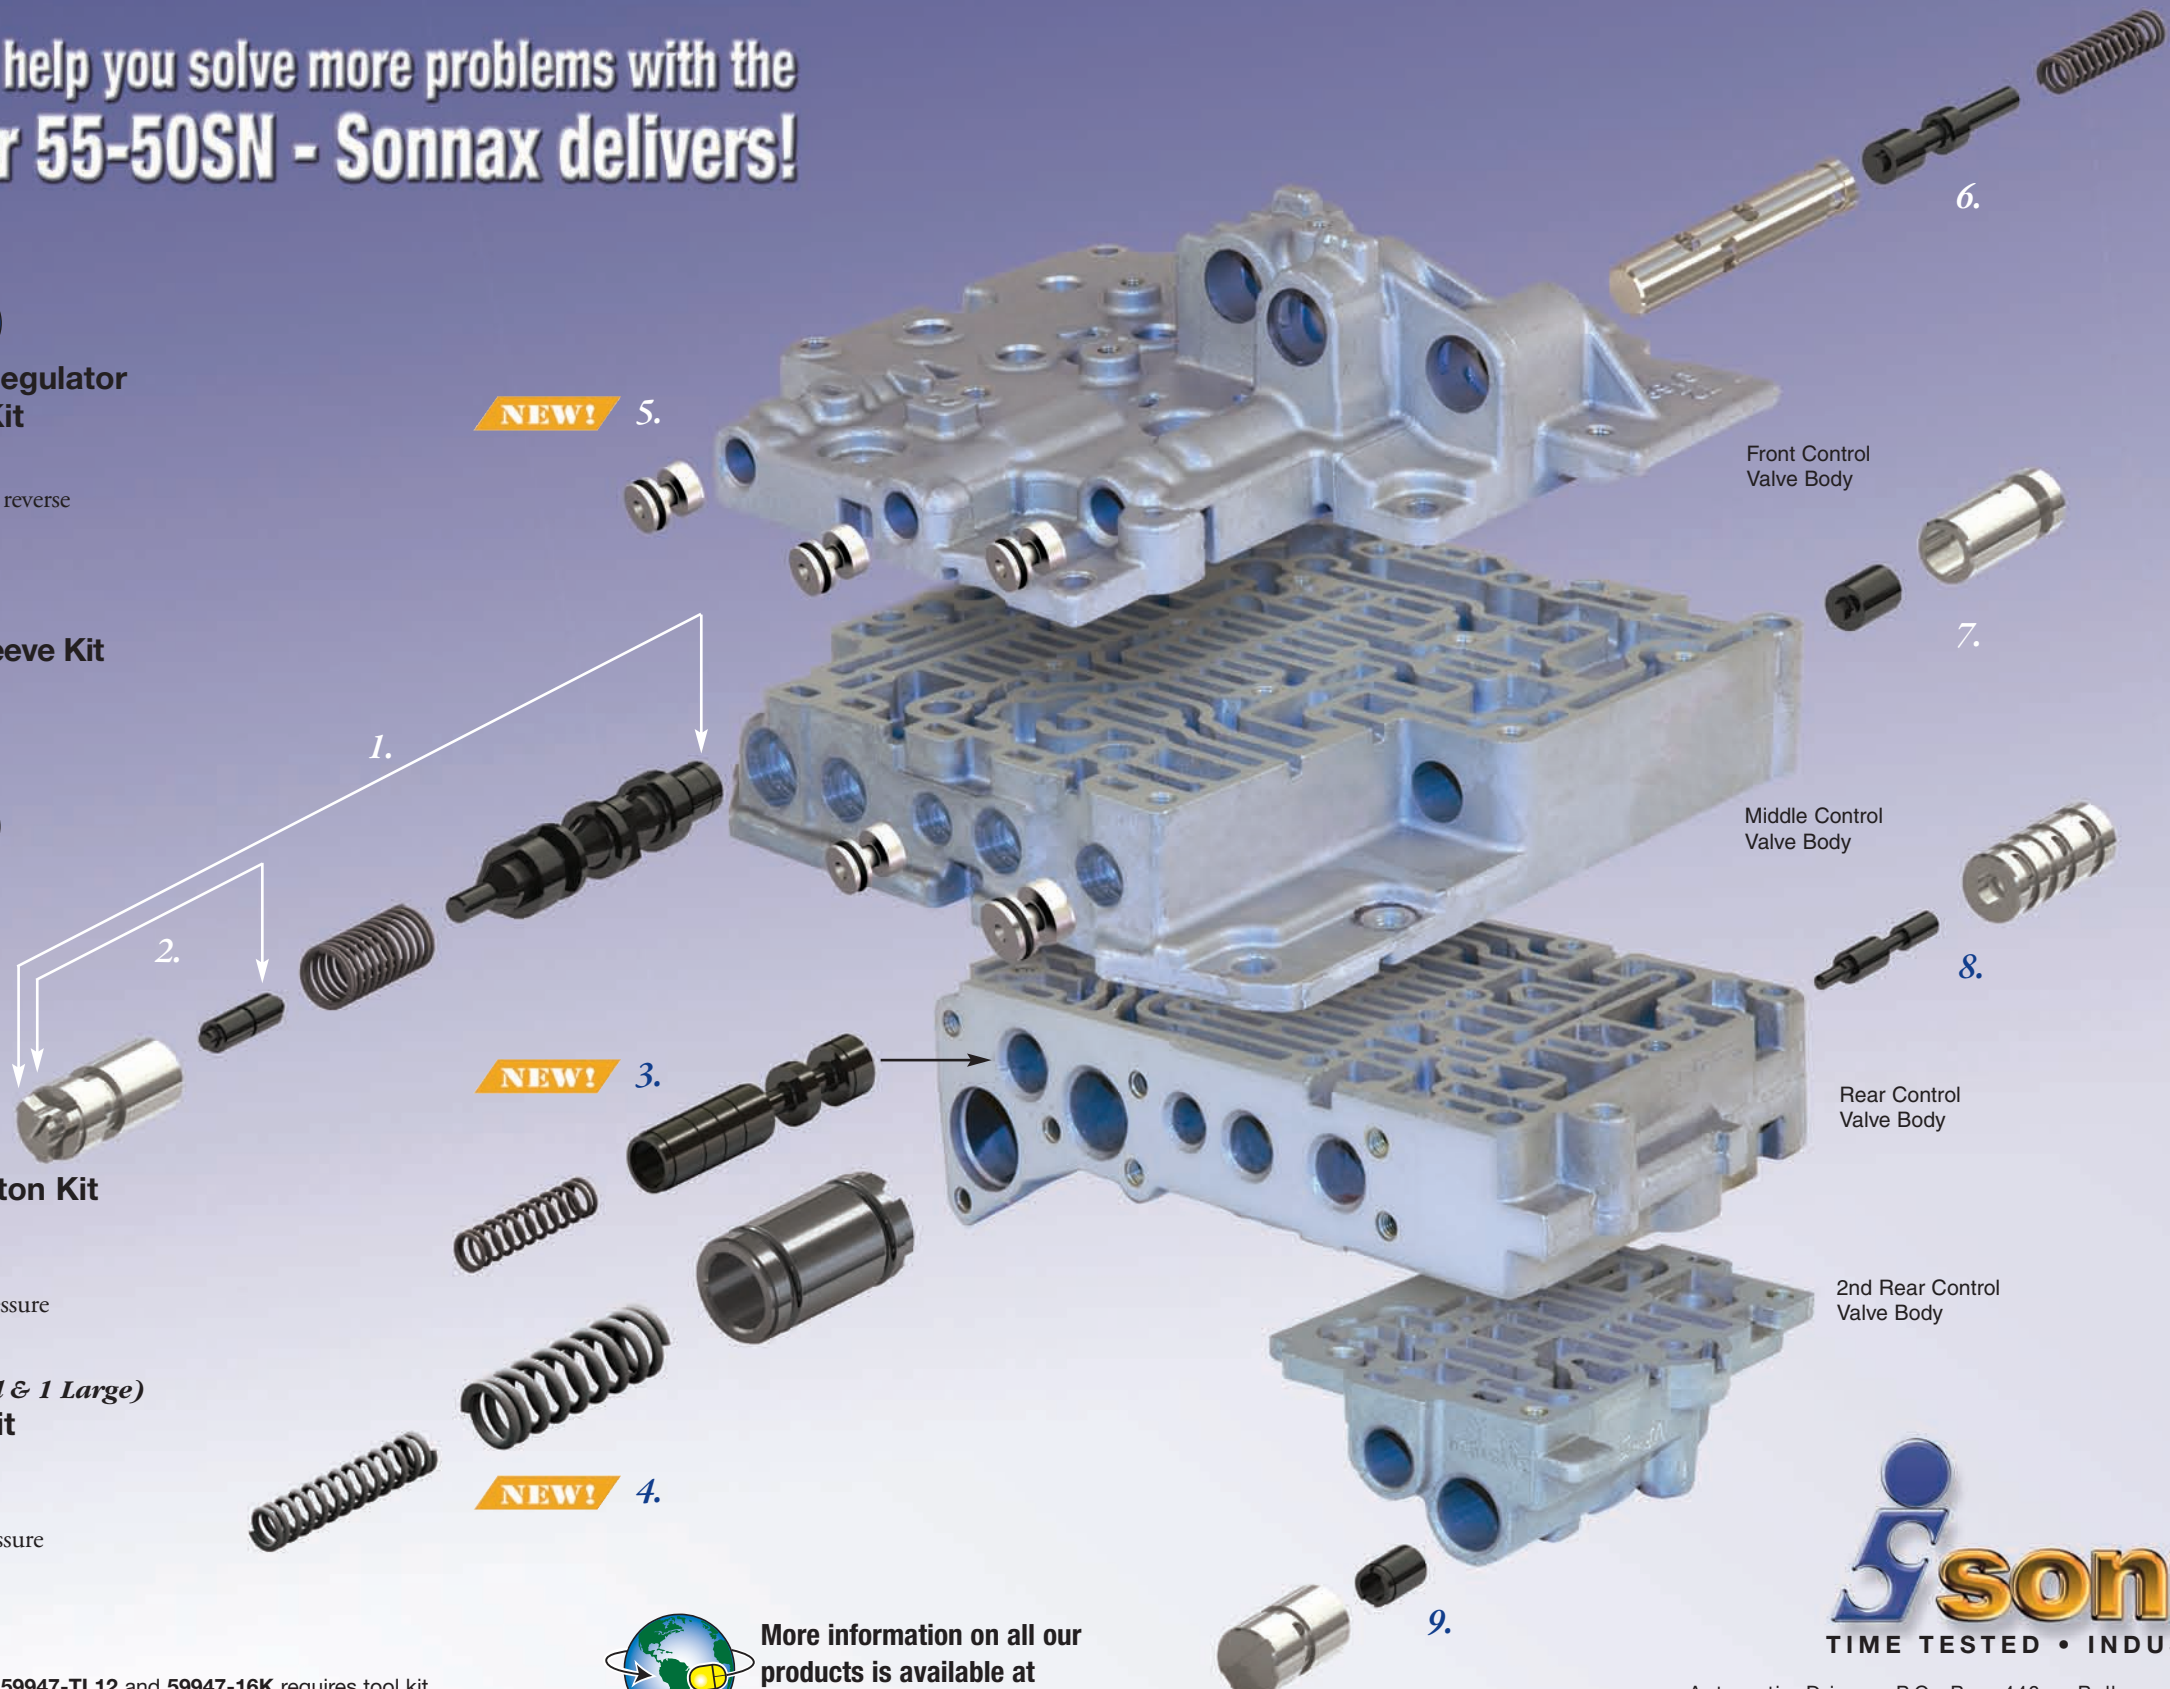

6. 59947-09K
Solenoid Modulator Valve Capsule Kit

Helps cure:

- TCC slip or RPM surge
- Low SLT pressure
- Delayed engagements

7. 59947-05K
Solenoid Relay Valve & Sleeve Kit

Helps cure:

- No TCC apply
- Loss of solenoid modulator oil pressure

8. 59947-01K
Lockup Relay Control Valve & Sleeve Kit

Helps cure:

- No TCC apply
- TCC cycle or RPM fluctuates

9. 59947-03K
Lockup Control Valve & Sleeve Kit

Helps cure:

- Excess TCC slippage
- Harsh downshifts or converter does not release



59947-12K requires tool kit F-59947-TL12 and 59947-16K requires tool kit F-59947-TL16 and both of these tool kits require the VB-Fix reaming fixture.



More information on all our products is available at www.sonnax.com



Automatic Drive • P.O. Box 440 • Bellows Falls, Vermont 05101-0440 USA
800-843-2600 • 802-463-9722 • F: 802-463-4059 • www.sonnax.com • info@sonnax.com

©2008 Sonnax Industries, Inc.